EE772 Series

FLOW METER for COMPRESSED AIR and GASES

Manual

Hardware and Software

YOUR PARTNER IN SENSOR TECHNOLOGY

E+E ELEKTRONIK® Ges.m.b.H.

BA_EE772_e // V1.2 // technical data are subject to change // 193628

E+E Elektronik® Ges.m.b.H. doesn't accept warranty and liability claims neither upon this publication nor in case of improper treatment of the described products.

The document may contain technical inaccuracies and typographical errors. The content will be revised on a regular basis. These changes will be implemented in later versions. The described products can be improved and changed at any time without prior notice.

© Copyright E+E Elektronik® Ges.m.b.H.
All rights reserved.

USA
FCC notice:

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the installation manual, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help.

Caution:
Any changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate this device.

CANADIAN
ICES-003 notification:

This Device B digital apparatus complies with Canadian ICES-003.
Cet appareil numérique de la classe B est conforme à la norme NMB-003 du Canada.

Table of contents - HARDWARE

1. GENERAL 4
1.1. Safety Instructions 4
1.1.1. Intended Use 4
1.1.2. Installation, start up and control 5
1.2. Environmental aspects 5
2. PRODUCT DESCRIPTION 6
3. INSTALLATION 7
3.1. Mounting dimensions 7
3.2. Determining installation site 8
3.3. Installation position 8
3.4. Required length of straight pipe 9
3.5. Assembly of the measurement section 10
3.5.1. Assembly without flowmeter, but with screw cap instead (blind cap) 10
3.6. Installation of the flowmeter sensing probe 10
3.6.1. Flow direction 10
3.6.2. Installation of the sensing probe into the MultiController 11
3.6.3. Installation of the sensing probe into the hot tap valve 12
4. ELECTRICAL CONNECTIONS 13
4.1. Connection diagram 13
4.1.1. Relay and pulse output, internal switching 13
4.1.2. Connection with optional plug for power supply and outputs (order code Q) 13
4.2. Bus Output (optional) 14
4.2.1. M-Bus (Meter-Bus) 14
4.2.2. Modbus RTU 14
4.2.3. Data Transmission 14
4.2.4. Addressing 14
5. CONTROL COMPONENTS 15
5.1. Jumper J1 and J2 15
5.2. Digital interface USB (for configuration) 15
5.3. Display / Indicator with keypad (optional) 16
5.3.1. Indication of the analogue and pulse output 16
5.3.2. Indication of the switch output 16
5.3.3. Indication of the MIN / MAX values 17
5.3.4. Reset of the consumption counter or the MIN / MAX value 17
5.3.5. Maximum consumption counter 17
6. ERROR MESSAGES 18
7. MAINTENANCE 18
7.1. Removal of the sensing probe of the MultiController 18
7.2. Removal of the sensing probe of the hot tap valve 18
7.3. Cleaning of the sensor of the flowmeter 18
8. REPLACEMENT PARTS / ACCESSORIES 19
8.1. Order Code Replacement Sensor 19
9. TECHNICAL DATA 20
9.1. Factory setting of outputs 21

Table of contents - SOFTWARE

1. General 22
2. Installation 22
2.1. Configuration of the USB Interface (VirtualCOM) 23
3. User Interface 24
4. Menu toolbar 24
4.1. File 24
4.2. Transmitter 25
4.3. Extras 25
5. Input Screen 25
5.1. Output 1, Output 2 25
5.1.1. Output mode 25
5.1.2. Measurand 25
5.1.3. Units 25
5.1.4. Output mode – analogue 25
5.1.5. Output mode – switch (relay) 26
5.1.6. Output mode – pulse 27
5.2. Minimum flow shutdown 27
5.3. Display 27
5.4. Adjustment 28
5.4.1. 1-point adjustment 28
5.4.2. 2-point adjustment 29
5.4.3. Reset to factory settings 29
5.5. Measuring values overview 30
5.5.1. Reset of the MIN / MAX values 30
5.5.2. Reset of the consumption counter (totalizer) 30
5.6. Setting up Process Parameters 30
5.6.1. Change the Process Gas 30
5.6.2. Changing the standard conditions 31
5.6.3. Pressure compensation 31
5.7. External pressure transmitter for pressure compensation 31
5.8. Bus configuration 31

1. GENERAL

This manual is a part of the scope of supply and serves to ensure optimal operation and functioning of the equipment.
For this reason, the manual must be read before start-up.
Therefore, it is necessary that this manual is read and understood by those responsible for the handling, installation, and maintenance of the equipment.

This manual may not be used for competitive purposes or passed on to third parties without the written consent of E+E Elektronik® Ges.m.b.H.
It is permitted to make copies for personal use.
All information, technical data and illustrations contained in these instructions are based on information available at the time of publication.

Symbol Clarification

This symbol indicates safety instructions.
The safety instructions have to be carried out unconditionally. If disregarded loss, injury, or damage may be inflicted to people and property. In any case E+E Elektronik® Ges.m.bH. cannot be hold responsible.

This symbol indicates attention.
The note should be observed to achieve an optimal functioning of the equipment.

1.1. Safety Instructions

1.1.1. Intended Use

The flowmeter is intended to be used for the measurement of air and other non-corrosive gasses in pipelines only. Consult the factory first before the measurement of wet or filthy gasses.

The design of the flowmeter allows for the EE772 to be installed in a pressurized system up to PN40 – is 40 bar (580 psi).

Prior to the start of the installation, the system has to be depressurized. Before the installation or removal of the sensing probe or the screw cap, the ball valve should be closed.

Mounting, electrical installation, putting in operation and maintenance should only be done by qualified personnel.

The use of the flowmeter EE772 in any other way than described in this manual bears a safety risk for people and the entire measurement installation and is therefore not allowed.

The manufacturer cannot be hold responsible for damages as a result of incorrect handling, installation, and maintenance of the equipment.

To avoid health risks or damage to the equipment, the installation should not be operated on with tools, which are not specifically mentioned or described in this manual.

Excessive mechanical stress and inappropriate handling must be avoided.

A short interruption of the flow using the ball valve cannot be avoided when exchanging the sensing probe.

The flowmeter can only be utilized in accordance with the conditions defined in the technical data. Otherwise, inaccuracies of the measurement will occur and equipment failures cannot be ruled out.

For the safety of the user and for the functionality of the equipment the recommended steps by the manufacturer to put into operation, to test and to maintain should be taken and completed.

1.1.2. Installation, start up and control

The flowmeter is designed and built in accordance with the latest state in technology, tested adequately and has been shipped from the factory in good order and condition.

As the user, you are responsible to comply with all applicable safety regulations amongst others:

- Instruction for the installation
- Local standards and codes

The manufacturer has taken all measures to assure safe operation. The user has to make sure that the equipment is positioned and installed in such a way that safe operation is not impaired.
The equipment is tested in the factory and shipped in good order and condition.
This manual contains information and notes of caution, which have to be adhered to by the user to assure a safe operation.

- Mounting, electrical installation, putting into operation and maintenance should only be done by qualified personnel. The plant operator should authorize qualified personnel to operate on the installation.
- It is necessary that this manual is read and understood by these professionals and that they follow the instructions as detailed in this manual.
- Check all connections of the entire installation thoroughly, before putting the system into operation.
- Do not put a damaged product into operation and make sure that that does not happen inadvertently.
- A malfunction of the equipment should only be handled and fixed by authorized and qualified personnel
- If it is not possible to repair the malfunction, put the equipment out of operation and make sure that it cannot be put back into operation again.
- Repairs not described in this manual may only be carried out by the manufacturer or by the respective service organization.

Disclaimer of Liability
The manufacturer or their delegated representative is only liable in case of intend or gross negligence. The accountability is limited to the value of the order issued at the time to the manufacturer.
The manufacturer is not liable for damages, originated from disregarding the safety instructions or violating the instructions of the manual or operating conditions.
Consequential damages are excluded from the any liability.

1.2. Environmental aspects

The products from E+E Elektronik® are developed and designed in due consideration to the importance of the protection of the environment. Therefore, disposal of the product also should not lead to pollution of the environment.

The single-variety components must be separated before the transmitter is disposed of. The electronic components must be collected and as electronic scrap properly be disposed of.

2. PRODUCT DESCRIPTION

The flowmeter of the series EE772, based on the measurement principle of thermal mass flow, is suited for the measurement of flow of air and gasses in pipelines. Measurement of for instance the consumption of compressed air, nitrogen, helium, CO2 or other non-corrosive and non-flammable gasses.

The EE772 measures the volume flow at standard conditions according to DIN 1343 (P_0=1023.25 mbar; t_0=273.15 K or 0 °C (32 °F). In addition to the standard volume flow, the measurand mass flow, norm flow and temperature are available.
The EE772 has an integrated consumption counter. The consumption quantity is indicated in the display and is not lost after a power failure. Two signal outputs are available. Depending on the application, the outputs can be configured as analogue (current or voltage), switch output or as pulse output for the measurement of the consumption.

1 **Signal conditioning with optional display**
The enclosure with the signal conditioning is mounted either on the measurement probe (model A or B compact) or is remote with a plugable sensor cable up to 10 meter (33 feet) – (model C with remote probe).

2 **Sensing probe with measurement electronics**
The interchangeable sensing probe contains the sensor element and the measurement electronics, in which the data of the factory calibration is stored. The sensing probe is easy and quickly interchangeable in the field, independent of the electronics for the signal conditioning. After the exchange, the configuration of the outputs is unchanged.

3 **Sensor cable (only by model C with remote sensing probe)**
The sensor cable allows for the remote installation, up to 10 meter (33 feet), of the sensing probe from the housing with the signal conditioning.

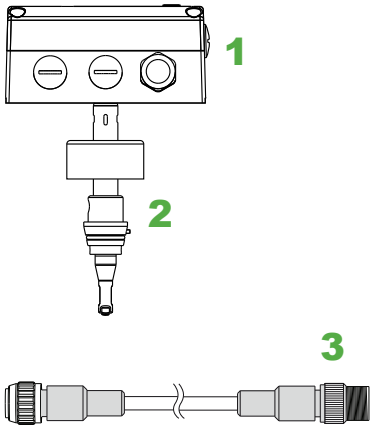

4 **Mounting valve - MultiController**
The mounting valve assembly allows for the easy and reliable installation within the pipeline. During installation in the pipeline, observe the required inlet and outlet paths (see page 9). The nominal size of the mounting valve must match the nominal size of the pipe. The MultiController is suitable for pressures up to 40 bar (580 PSI) and available for pipe diameters DN40 (1 1/2”) to DN80 (3”).

4a The MultiController with hot tap valve allows for the installment and removal of the sensing probe under pressure without interrupting the process flow.

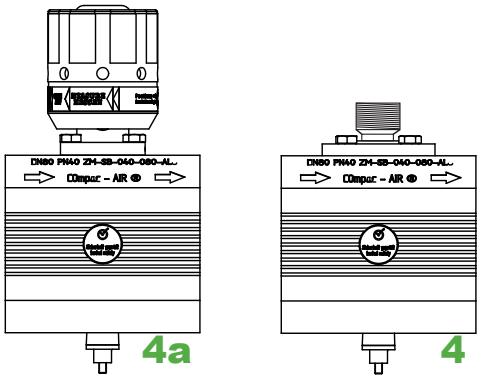

5 **Screw cap**
The screw cap, with female thread, is screwed in place if the flowmeter is not installed and the pipeline has to be used.



3. INSTALLATION

3.1. Mounting dimensions

EE772-A / EE772-B
Compact

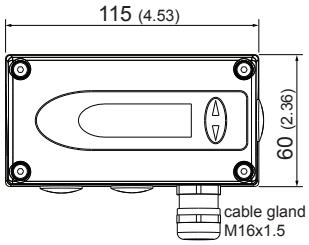

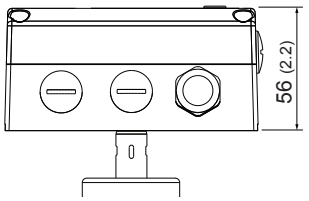

dimensions in mm (inch)

EE772-C
Remote probe

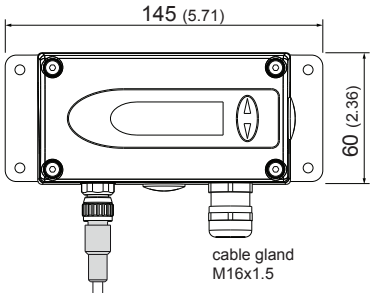

The bottom part of the housing is mounted with 4 screws (not in the scope of supply). Max. screw diameter: 4.5 mm (0.17 inch).
e.g. 4.2 x 38 mm DIN 7938H Screws

Drilling Plan:

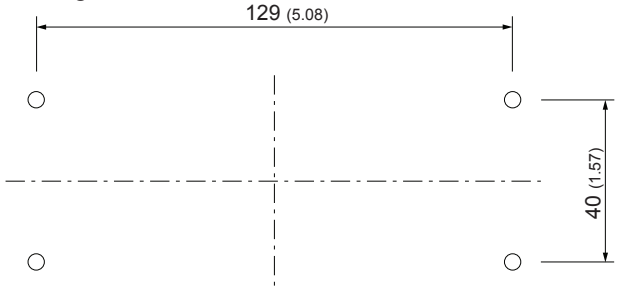

HA071xxx
Mounting MultiController

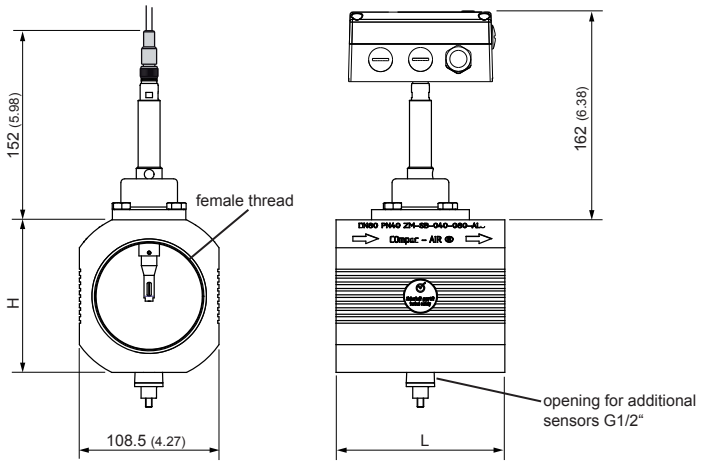

HA072xxx
Mounting MultiController with hot tap valve

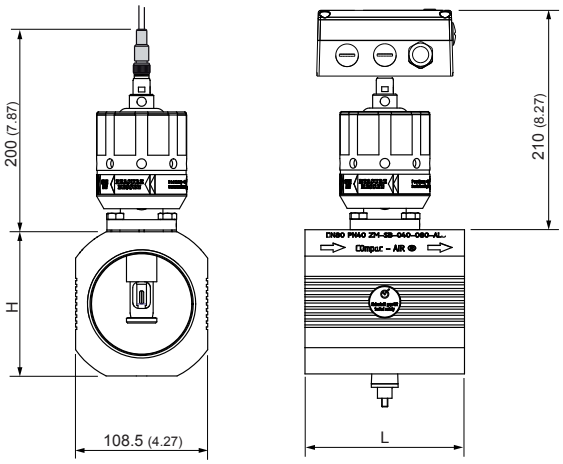

pipe diameter	Thread	L	H
DN40 (1 1/2”)	R_p or NPT 1 1/2"	110 (4.33)	108.5 (4.27)
DN50 (2”)	R_p or NPT 2"	131 (5.16)	108.5 (4.27)
DN65 (2 1/2”)	R_p or NPT 2 1/2"	131 (5.16)	108.5 (4.27)
DN80 (3”)	R_p or NPT 3"	131 (5.16)	118.5 (4.67)

dimensions in mm (inch)
female thread:
Whitworth-Thread acc. EN 10226 (old DIN 2999) or NPT

3.2. Determining installation site

- The installation site should be easy accessible and free of vibrations and shocks.
- Observe at least 260 mm (10.24 inch) clearance above the housing with the signal conditioning, in order to be able to remove the sensing probe if necessary.
- The ambient temperature should not exceed the value as stated in the specifications (see page 20) – consider heating by radiation.
- The fluid should not condense at the installation site. Condensation on the tip of the sensing probe must be avoided.
- In compressed air systems, the installation should be downstream of the dryer.
- Observe the direction of the flow by the installation (see page 10).
- Observe the recommended straight pipe lengths up and downstream, in order to warrant the specified measurement accuracy.
- The flowmeter should be installed as far as possible from any flow disturbance. Valves or check-valves should be installed in a respective distance from the flowmeter.

3.3. Installation position

Make sure that the arrow on the tip of the sensing probe is pointing in the direction of the flow.

		Model	
Vertical Mounting		Compact	Remote
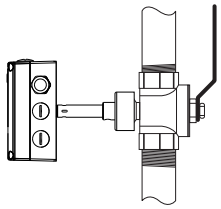	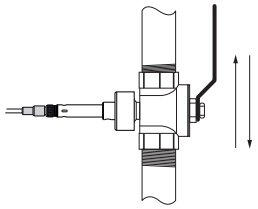	+	++
Horizontal Mounting, sensor upwards			
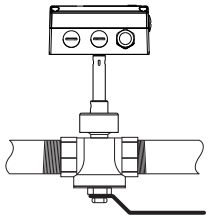	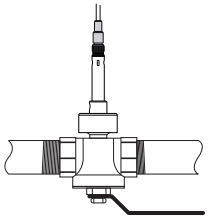	++	++
Horizontal Mounting, sensor downwards			
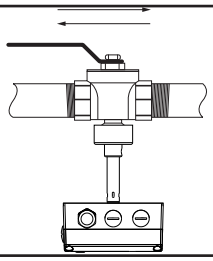	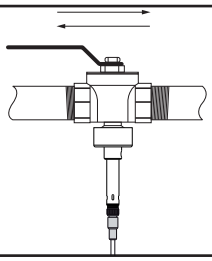	-	-
Horizontal Mounting, sensor across			
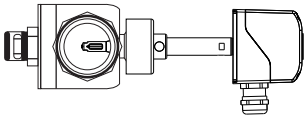		+	++

++ ... recommended installation position
+ ..... not recommended if there is vibration on the pipeline
- ..... not recommended

3.4. Required length of straight pipe

The flowmeter should be installed as far as possible from disturbances of the flow. The causes for disturbance of the flow are for instance, reducers, elbows, T-pieces, valves, gate valves, etc. The specified measurement accuracy can be achieved only when the following straight inlet and outlet pipe lengths are installed:

- The wall thickness of the inlet and outlet pipe should be 2,6 mm
- The stated values are as a minimum. If possible, allow for greater distances.
- Valves or gate valves should be installed downstream of the flowmeter.
- With lighter gasses the inlet straight pipe should be longer.

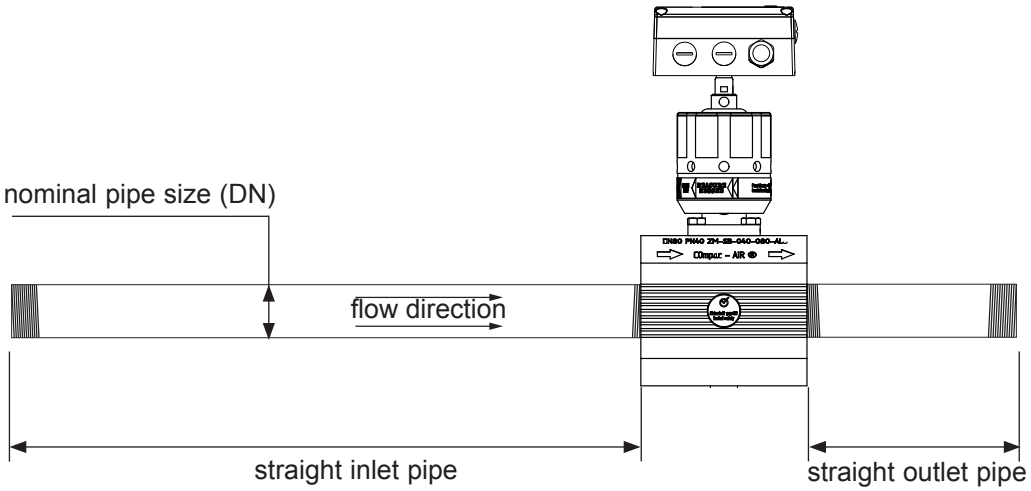

	Type	(DN = Nominal Pipe Size)	
		Straight inlet pipe	Straight outlet pipe
	Extension	15 x DN	5 x DN
	Reduction	15 x DN	5 x DN
	90° - elbow	20 x DN	5 x DN
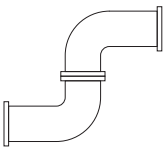	Two 90° - elbows, in one level	25 x DN	5 x DN
	Two 90° - elbows, in two levels	30 x DN	5 x DN
	Valve, gate valve	50 x DN	5 x DN

3.5. Assembly of the measurement section

In order to install or remove the measurement section the pipeline system should be depressurized.

- All connections to be made with appropriated sealing material on the threads.
- The sealing material should not change the area of the inner cross section of the pipe. It must be warranted that the connections after installation are free of leaks.
- All fittings must be tested on seal tightness.
- Make sure during the assembly of the measurement section that the arrows on the pipe section and the ball valve are pointing in the same direction as the flow.
- The recess for the alignment pin must be at the side of the outlet.

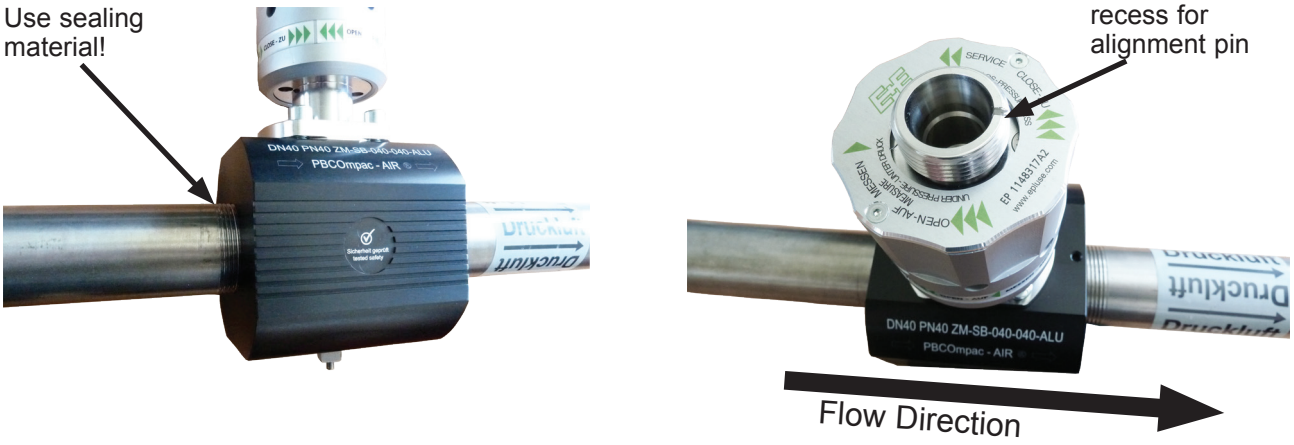

3.5.1. Assembly without flowmeter, but with screw cap instead (blind cap)

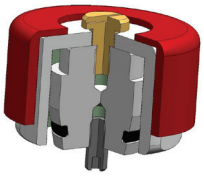

In order to use the measurement section without the flowmeter, the blind screw cap (in the scope of supply) must be screwed tight onto the opening of the MultiController. If not needed the screw cap can be screwed and stored on the side of the MultiController.

3.6. Installation of the flowmeter sensing probe

3.6.1. Flow direction

The flow direction is indicated with an arrow on the tip of the probe. Due to the alignment pin is the installation of the sensing probe in the MultiController only possible in the direction of the flow. After a removal, the sensing probe will be re-installed in the measurement section in exactly the same position as done at the factory. Hence, the highest reproducibility is guaranteed.

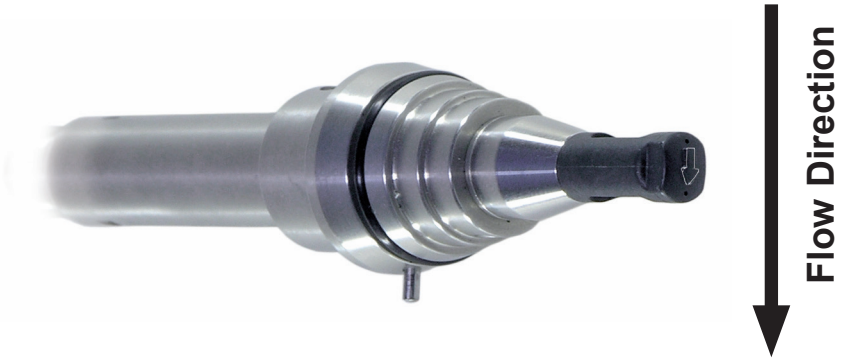

3.6.2. Installation of the sensing probe into the MultiController

Make sure that the pipe line is depressurized!

- Remove transport protection cap of the head of the sensing probe.

- Mount the sensing probe in the MultiController in such a way that the alignment pin fits in the recess on the MultiController.

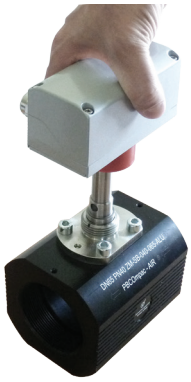

- Screw the retainer nut by hand so far that a certain resistance is noticeable.
- Check the correct installation position of the flowmeter. The alignment pin must fit in the recess on the ball valve.
- Tighten the red coloured retainer nut by hand. Tightening by hand should be sufficient. However, if the seal is not leak tight carefully tighten the nut with an appropriate tool a bit further

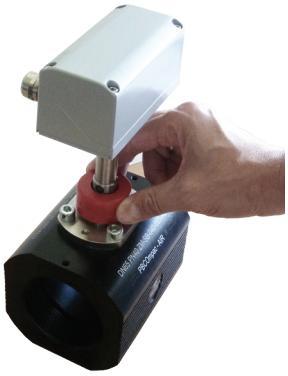

- The mechanical installation of the flowmeter is therewith completed.

3.6.3. Installation of the sensing probe into the hot tap valve

The hot tap valve allows for the instalment and removal of the sensing probe under pressure, without interrupting the process flow.

Operate the hot tap valve only with the hand, without tools!

Functionallity:
Position OPEN - MEASURE: The sensor head is immersed into the pipe.
Position CLOSE - SERVICE: The hot tap valve pressure tight closed. You can remove the sensor probe.

OPEN-MEASURE

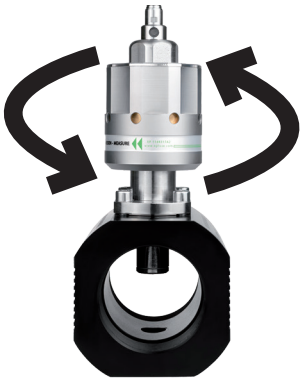

CLOSE-SERVICE

- Turn the hot tap valve in position CLOSE - SERVICE and mount the sensing probe in the hot tap valve in such a way that the alignment pin fits in the recess on the sealing cone.

- Screw the retainer nut by hand so far that a certain resistance is noticeable.
- Check the correct installation position of the flowmeter. The alignment pin must fit in the recess on the sealing cone.
- Tighten the retainer nut by hand. Tightening by hand should be sufficient. However, if the seal is not leak tight carefully tighten the nut with an appropriate tool a bit further.
- Turn the hot tap valve in position OPEN - MEASURE.

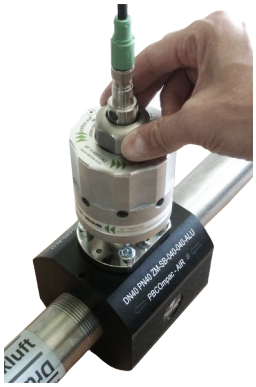

- The mechanical installation of the flowmeter is therewith completed.

4. ELECTRICAL CONNECTIONS

Before electrical connections are made turn off the power supply first. If not observed the electronics can be damaged as a result.
Only a qualified electrotechnical engineer may install the device.

- Unscrew the four screws and remove the cover of the housing.
- The screw terminals are located in the bottom part of the housing.
- For the electrical connection of the flowmeter a six-wire cable is needed (e.g. 6 x 1 mm² (AWG 17))

4.1. Connection diagram

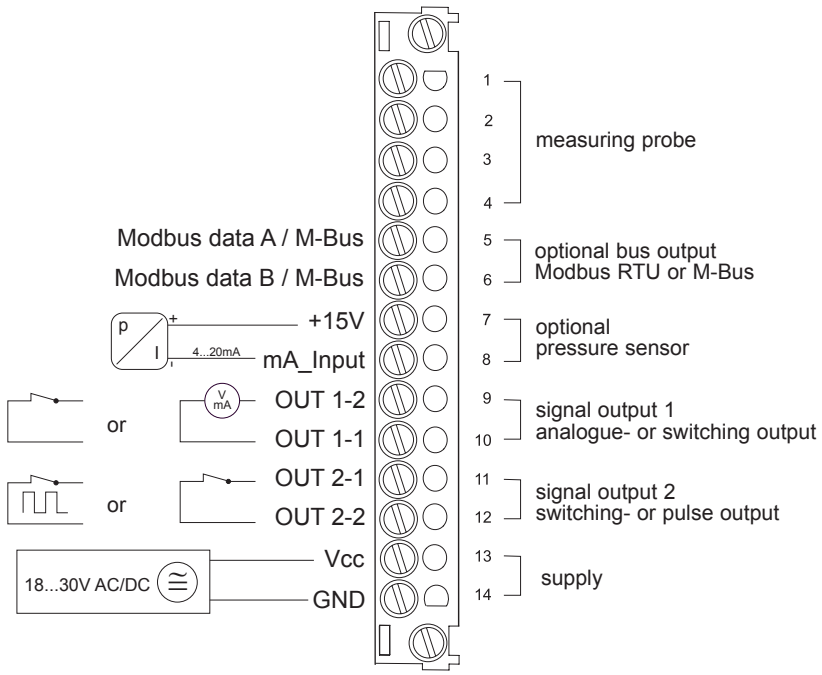

- Screw terminal OUT 1-1 for the analogue output is internally connected with GND.
- The housing should be grounded to achieve optimal electromagnetic compliance.

4.1.1. Relay and pulse output, internal switching

The relay switch and pulse outputs are both potential free.

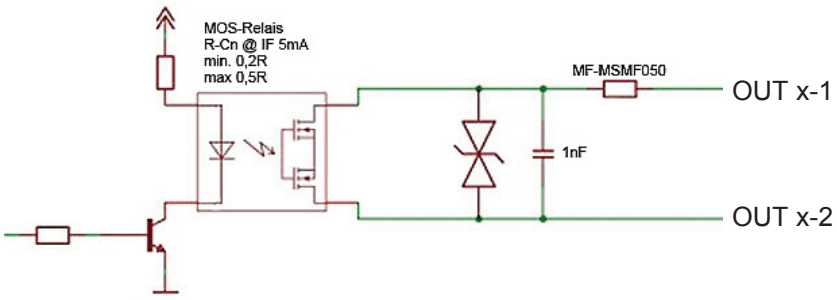

4.1.2. Connection with optional plug for power supply and outputs (order code Q)

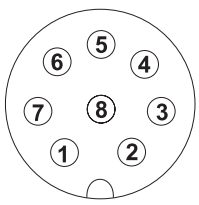

Connection plug for the power supply and analogue outputs (rear view of the terminals)

Pin	Assignment
1	OUT 2-2
2	OUT 1-2
3	OUT 1-1
4	GND
5	OUT 2-1
6	n.c.
7	Vcc
8	n.c.

4.2. Bus Output (optional)

4.2.1. M-Bus (Meter-Bus)

The M-Bus (Meter-Bus) is a field bus for recording consumption data. The transmission is carried out serially on a reverse polarity protected two-wire line.
The following measurements are transmitted:

- Standardized volumetric flow [Nm^3/h]
- Mass flow [kg/h]
- Temperature [°C]
- Consumption reading [m^3]

The flowmeter as M-Bus slave requires a separate supply voltage!
There is no specific topology (phase or star) prescribed for the cabling. Normal telephone cable of type J-Y(St)Y Nx2x0.8 mm can be used. A maximum of 250 meters is permitted per segment.

4.2.2. Modbus RTU

The measured values are stored as a 32Bit float value between 0x19 and 0x21. Depending on the measurement unit selected, the measurements are saved in SI or US/GB units. The measurement unit can be changed using the configurator software.

Modbus Map:

Register Address	Protocol Address	Measuring Value	SI-Unit	US/GB-Unit
30026	19	Standardized Flow	Nm/s	SFPM
30028	1B	Standardized Volumetric Flow	Nm^3/h	SCFPM
30030	1D	Temperature	°C	°F
30032	1F	Massflow	kg/h	kg/h
30034	21	Consumption reading	m^3	ft^3

4.2.3. Data Transmission

	Factory Setting	Adjustable Values	
		M-Bus	Modbus RTU
Baud Rate	9600	600...9600	9600...57600
Data Bits	8	8	8
Parity	NONE	None, Odd, Even	None, Odd, Even
Stop Bits	1	1 or 2	1 or 2
Slave-Address	1	0...254	1...247

4.2.4. Addressing

The flowmeters are factory-set to address 1. The slave address can be set via switches on the PCB.

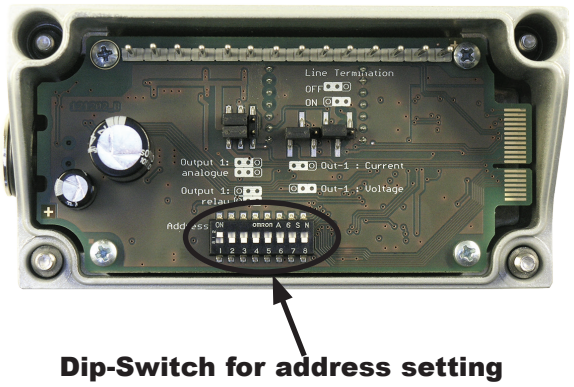

Dip-Switch for address setting



Factory Setting:
Slave-Address = 1

Slave-Address = 255
The address set using the configurator software is used.

5. CONTROL COMPONENTS

5.1. Jumper J1 and J2

If the signal output is altered from relay to analogue output or vice versa, Jumper **Output 1** has to be relocated.

If the analogue output is altered from a current to a voltage output or vice versa, Jumper **Out-1** has to be relocated.

signal output 1 = switching output



signal output 1 = analogue output



Jumper Output 1

Modbus RTU only

Line Termination = OFF

Line Termination = ON
150 Ohm parallel to
bus output A and B

Jumper Line Termination

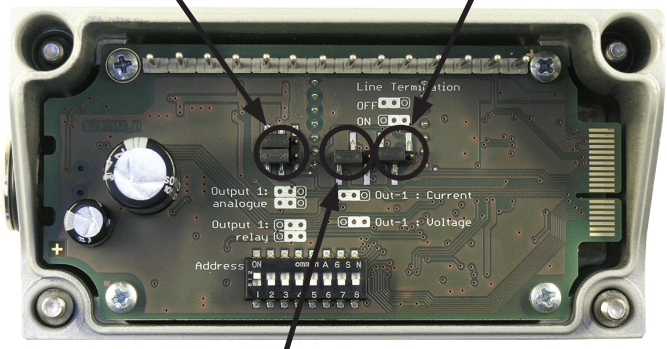

Jumper Out-1

analogue output = current signal (e.g. 4-20mA)

analogue output = voltage signal (e.g 0-10V)

5.2. Digital interface USB (for configuration)

The USB connector is behind the blind screw cap, at the side of the housing.

- remove the blind screw cap with a screwdriver
- plug in the USB connector

Install the configuration software, which is in the scope of supply. The configuration software is available for downloading as well from our website at www.epluse.com

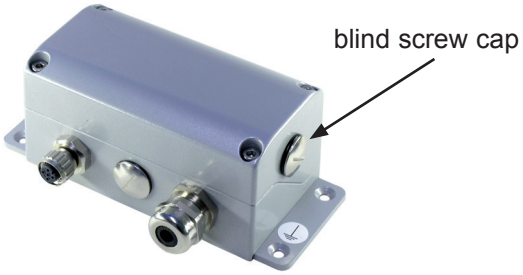

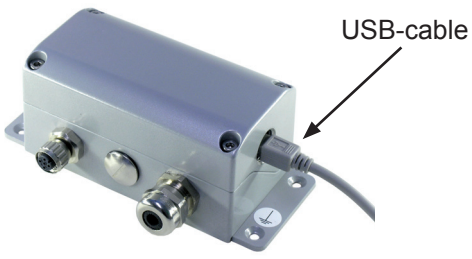

5.3. Display / Indicator with keypad (optional)

An optional two-line display is available for the flowmeter EE772. The display is an integral part of the cover of the housing and has two soft-keys for the control of the indicator.

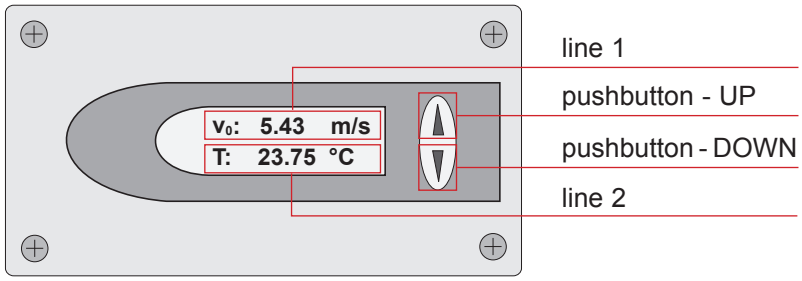

Depending on the configuration of the outputs either the measured values, the status of the relay or the consumption is indicated.

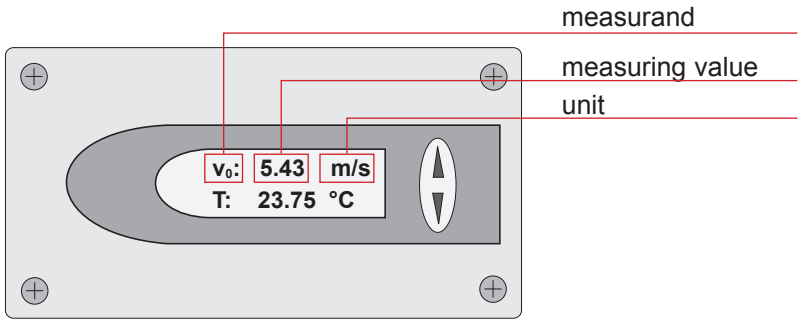

Measurand		SI Unit	US Unit
v_0	Standardized Flow	m/s	SFPM
T	Temperature	°C	°F
$\dot{V}_0$	Standardized Volumetric Flow	m^3/h; m^3/min; l/min	SCFM; SLPM
m	Massflow	kg/h; kg/min; kg/s	kg/h; kg/min; kg/s
Q	Consumption	m^3	ft^3
p	Pressure	bar	psi

5.3.1. Indication of the analogue and pulse output

Line 1 indicates always the configured measurand at output 1. In line 2 the desired measurement value can be indicated using the UP and DOWN keys.

5.3.2. Indication of the switch output

Line 1 indicates the status of the switch output. In line 2 the desired measurement value can be indicated using the UP and DOWN keys.

The display shows an inverse image if the relay output is active (relay has switched).

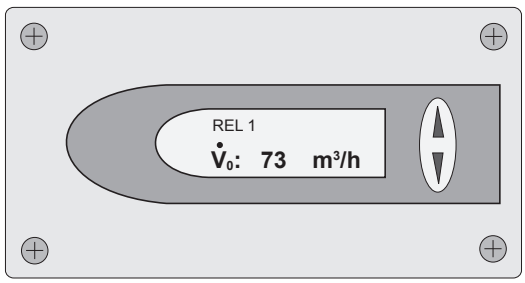

Switch output inactive (relay has not switched)

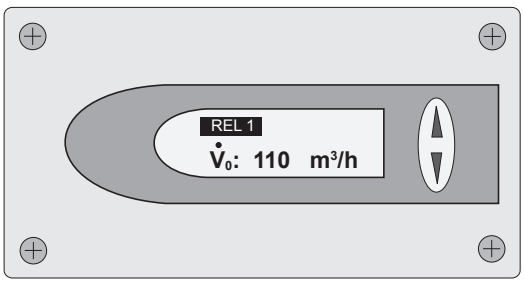

Switch output active (relay has switched)

5.3.3. *Indication of the MIN / MAX values*

Keep the DOWN key pressed for > 5 sec to indicate the MIN value.
Keep the UP key pressed for > 5 sec to indicate the MAX value.

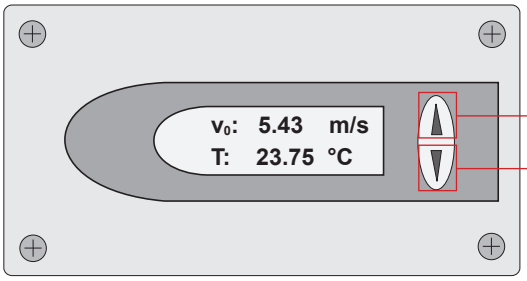

After that the several different measurement values can be indicated using the UP or DOWN keys.
Keep the DOWN or UP key pressed for > 5 sec to exit the MIN / MAX mode.

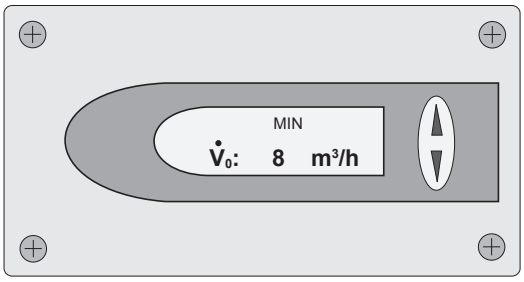

5.3.4. *Reset of the consumption counter or the MIN / MAX value*

Keep both the UP and DOWN key pressed for > 5 sec to enter the menu for resetting the consumption counter or the MIN / MAX value.
Select the desired menu item by pressing the UP or DOWN key briefly.

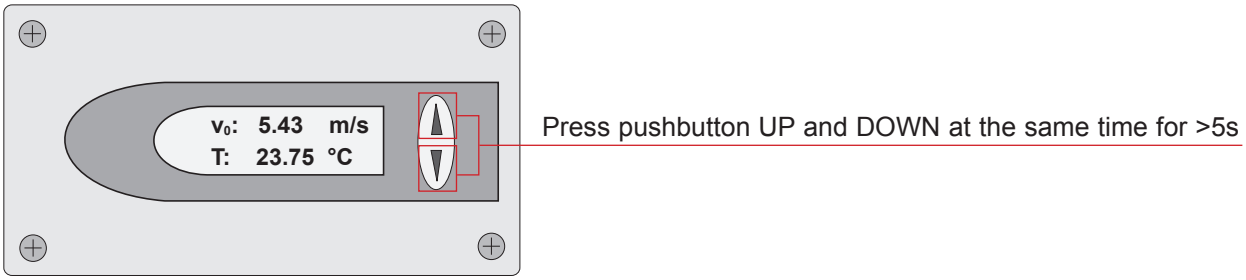

To confirm the selected choice of the menu keep the DOWN or UP key pressed for > 5 sec.
Select menu item “NO” or “EXIT” to cancel without resetting.

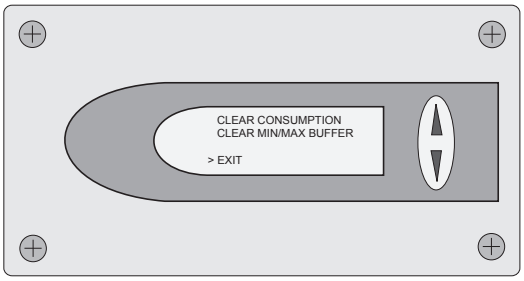

5.3.5. *Maximum consumption counter*

The maximum consumption counter readout on the display is 99.999* 10^6 m^3 (99.999 million m^3). Then the display starts blinking. The internal memory continues counting. The maximum counter reading is 3.4 * 10^{38} m^3. It is possible to read-out the counter reading with the configuration software.

6. ERROR MESSAGES

In case the flowmeter is equipped with the optional display, the following error message can be indicated.

ERROR 01: sensing probe is not detected

Cause: the sensing probe is not connect or is defect
Effect: the display indicates “0” for all measurand. The analogue output defaults to the lowest configured value.
Action: check the head of the sensing probe for visual damage.
check the sensor cable from the sensing probe to the electronics of the signal conditioning.

ERROR 02: the EEprom is defect

Cause: the EEPROM for the storing of the consumption counter and MIN /MAX value is defect.
Effect: the consumption counter and MIN / MAX values are no longer available. All measurement values though are still indicated. The analogue, relay and pulse output are still functional.
Action: return the flowmeter to the manufacturer.

7. MAINTENANCE

7.1. Removal of the sensing probe of the MultiController

MultiController without hot tap valve
Make sure that the pipe line is depressurized!

- Loose the retainer nut and pull the sensor probe from the MultiController.
- Operation without the flowmeter installed page 10.

7.2. Removal of the sensing probe of the hot tap valve

The sensor can be removed under pressure without flow interruption.

- Turn the hot tap valve with the hand without tools (anti-clockwise rotation) in the position SERVICE - CLOSE.
- Only if the hot tap valve is fully in the position SERVICE - CLOSE the sensor is hermetically sealed against the pressurized line.
- Loose the retainer nut slowly. Let the air exhaust slowly and make sure that is was only the relief pressure and the hot tap valve is hermetically sealed.
- Loose the retainer nut and pull the sensor probe from the hot tap valve.
- Operation without the flowmeter installed page 10.

The sensor head is sensitive. Use the protection cap for transport and storage!

7.3. Cleaning of the sensor of the flowmeter

Do not use an abrasive cleaning agent, an organic solvent containing halogen or acetone.

- Clean the head of the sensor probe by carefully swirling in warm water of isopropyl alcohol. It is recommended to use isopropyl alcohol if the pollution is crease or oil.

The sensor should not be touch by fingers or solid objects like screwdrivers or brushes!

- Leave the sensor to dry in ambient air.

8. REPLACEMENT PARTS / ACCESSORIES

8.1. Order Code Replacement Sensor

			EE772-R-
Hardware Configuration			
Model	compact ri-le	direction od flow right to left	**A**
	compact le-ri	direction od flow left to right	**B**
	remote probe		**C**
Working range	high	(0,5...200 Nm/s) or (100...39370 ft/min)	**H1**
Measuring pipe - diameter	DN40		**N040**
	DN50		**N050**
	DN65		**N065**
	DN80		**N080**
Mounting	MultiController		**M**
	MultiController with hot tap valve		**W**
Plug [1)]	cable gland		**A**
	1 plug for power supply and outputs		**Q**

[1)] only for model A and B

Order Example

EE772-R-AH1N065MQ

Model:	Compact ri-le
Working range:	high
Measuring pipe - diameter:	DN65
Mounting:	MultiController
Plug:	1 plug for power supply and outputs

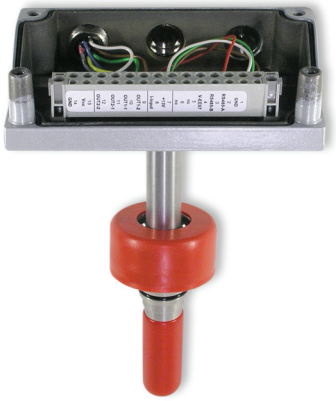

Order Example

EE772-R-CH1N065M

Model:	remote probe
Working range:	high
Measuring pipe - diameter:	DN65
Mounting:	MultiController

9. TECHNICAL DATA

Measuring value

Flow

Measurand		Volumetric flow at standard conditions acc. DIN 1343 P_0 = 1013.25 mbar (14.7 PSI); t_0 = 0 °C (32°F)	
Measuring range			
standardized volumetric flow in air	DN40 (1 1/2"):	2.26...904 Nm³/h	1.33...531.8 SCFM
	DN50 (2"):	3.50...1400 Nm³/h	2.06...823.6 SCFM
	DN65 (2 1/2"):	5.97...1400 Nm³/h	3.51...823.6 SCFM
	DN80 (3"):	9.04...1400 Nm³/h	5.32...823.6 SCFM
standardized flow in air, CO2,	≤DN50 (2"):	0.5...200 Nm/s	100...39370 SFPM
nitrogen	DN65 (2 1/2"):	0.5...117 Nm/s	100...23031 SFPM
	DN80 (3"):	0.5...77 Nm/s	100...15157 SFPM
helium	≤DN50 (2"):	0.5...120 Nm/s	100...23622 SFPM
	DN65 (2 1/2"):	0.5...117 Nm/s	100...23031 SFPM
	DN80 (3"):	0.5...77 Nm/s	100...15157 SFPM
Accuracy in air at 7bar (101.5 Psi) (abs) and 23°C (73°F)[1]		± (1.5% of measuring value + 0.5% of full scale)	
Temperature coefficient		± (0.1% of measuring value/°C)	
Pressure coefficient [2]		0.5% of measuring value / bar	
Response time t_{90}		< 1 sec.	
Sample rate		0.5 sec.	

Temperature

Measuring range		-20...80 °C (-4...176 °F)	
Accuracy at 20°C (68°F)		± 0.7 °C (1.26 °F)	

Outputs

Output signal and display ranges are freely scalable

Analogue output	voltage	0 - 10 V	max. 1 mA
	current (3-wire)	0 - 20 mA and 4 - 20 mA	R_L<500 Ohm
Switching output		potential-free max. 44 VDC, 500 mA switching capacity	
Pulse output		Totalizer, pulse length: 0.02...2 sec.	
Bus output (optional)		MODBUS RTU or M-BUS (Meter-Bus)	
Digital interface		USB (for configuration)	

Input

Optional pressure compensation	4 - 20 mA (2-wire; 15 V) for pressure sensor

General

Supply voltage		18 - 30 V AC/DC	
Current consumption		max. 200 mA (with display)	
Temperature range		ambient temperature:	-20...60 °C (-4...140 °F)
		medium temperature:	-20...80 °C (-4...176 °F)
		storage temperature:	-20...60 °C (-4...140 °F)
Nominal pressure		40 bar (580 Psi)	
Humidity		no condensation	
Medium		compressed air or none corrosive gases	
Connection		cable gland M16x1.5 (optional connector M12x1 8pol.)	
Electromagnetic compatibility		EN61326-1 Industrial Environment	EN61326-2-3 CE
Material	housing	metal (AlSi3Cu)	
	probe	stainless steel	
	sensor head	plastic (PBT)	
	ball valve	brass	
	MultiController	Aluminium	
Housing protection class		IP65 / Nema 4	

1) The accuracy statement includes the uncertainty of the factory calibration with an enhancement factor k=2 (2-times standard deviation). The accuracy was culated in accordance with EA-4/02 and with regard to GUM (Guide to the Expression of Uncertainty in Measurement).

2) The flow meter is calibrated at 7 bar (abs) 101.5 Psi. If the working pressure is different from 7 bar (101.5 Psi) you can compensate the error by setting the actual pressure with the configuration software.

9.1. Factory setting of outputs

SI-Unit

Analogue output [0...10 V / 0(4)...20 mA]		from	to	unit
standardized volumetric flow	DN40	0	900	Nm^3/h
	≥DN50	0	1400	Nm^3/h
mass flow	DN40	0	1140	kg/h
	≥DN50	0	1780	kg/h
standardized flow	DN40	0	200	Nm/s
	DN50	0	200	Nm/s
	DN65	0	117,25	Nm/s
	DN80	0	77,41	Nm/s
temperature	all Ø	-20	80	°C

Switching output			[switching point/hysteresis]	
standardized volumetric flow	DN40		720/72	Nm^3/h
	≥DN50		1120/112	Nm^3/h
mass flow	DN40		920/92	kg/h
	≥DN50		1400/140	kg/h
standardized flow	DN40		180/18	Nm/s
	DN50		180/18	Nm/s
	DN65		80/8	Nm/s
	DN80		60/6	Nm/s
temperature	all Ø		70/7	°C

US-Unit

Analogue output [0...10 V / 0(4)...20 mA]		from	to	unit
standardized volumetric flow	DN40:	0	520	SCFM
	≥DN50:	0	820	SCFM
mass flow	DN40:	0	1140	kg/h
	≥DN50:	0	1780	kg/h
standardized flow	DN40	0	39370	SFPM
	DN50	0	39370	SFPM
	DN65	0	23081	SFPM
	DN80	0	15238	SFPM
Temperatur	alle Ø	-4	176	°F

Switching output			[switching point/hysteresis]	
standardized volumetric flow	DN40:		420/42	SCFM
	≥DN50:		660/66	SCFM
mass flow	DN40:		920/92	kg/h
	≥DN50:		1400/140	kg/h
standardized flow	DN40		30000/3000	SFPM
	DN50		30000/3000	SFPM
	DN65		15000/1500	SFPM
	DN80		10000/1000	SFPM
temperature	all Ø		150/15	°F

CONFIGURATION SOFTWARE

LIMITED LIABILITY

E+E Elektronik shall not be held liable for any damages or consequential damages (for example, but not restricted to, loss of earnings, interruption of business, loss of information and data or any other financial losses) resulting from the installation, use or impossibility of use of an E+E Elektronik software product and any associated support services or non-performance of support services.

1. General

The configuration software, in the scope of supply, allows for a user-friendly adaptation of the flowmeter to the application. In addition, the measurement values for flow and temperature can be calibrated / adjusted.

The system requirements for the installation and execution of the software are:

- Windows XP with SP3, Windows Vista or Windows 7
- .NET framework 3.5 with SP1
- USB 2.0 interface

During setup there will be no installation of .NET Framework 3.5 SP1 – if the required version is not already installed on the computer the following error message will appear at the start of the configuration software.

.NET Framework 3.5 SP1 can be installed using Windows Update.

2. Installation

In order to set up a smooth installation of the configuration software of the EE772, admin authorization for the personal computer is required.

- Place the CD-ROM in the drive tray of the computer.
- At this moment the EE772 should NOT be connected with the USB cable to the computer.
- The setup program will start automatically with the Auto Run-function – in case the program does not start automatically, one can start the setup software manually by starting Setup.exe directly.
- The InstallShield-Wizard for the EE772 configurator will be started.
- Follow the instructions on the screen to install the software.

At first, the configuration software will be installed and then the installation of the USB driver activated – except if the user has defined that USB setup is disabled.
The USB driver will be automatically installed the moment the first connection is made with the EE772.
The appearing dialog boxes can be dealt with the settings “No. do not download driver from the internet” and “Install the hardware automatically”.

If the EE772 configuration software and the USB driver are installed correctly, and the EE772 is connected via the USB interface with the personal computer, a connection “Silicon Labs CP210x USB to UART Bridge” should have been created in the device manager.

See: Start => Settings => Control Panel => System => Hardware => Device Manager

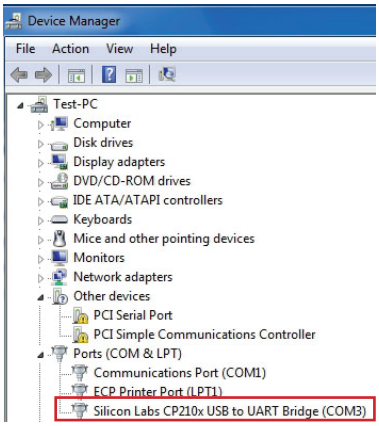

2.1. Configuration of the USB Interface (VirtualCOM)

After the startup of the software, the correct VirtualCOM interface for the USB driver must be configured
The number for the used USB interface can be found under:
Start => Settings => Control Panel => System => Hardware => Device Manager

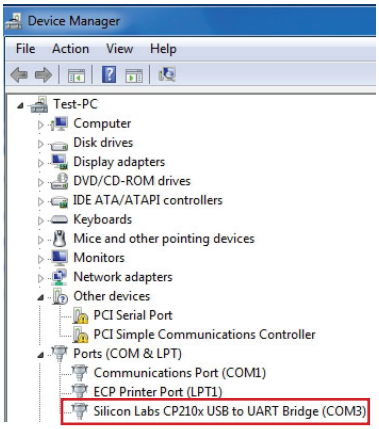

The setting is done under menu “Extras” and menu item “Optional extras…..”

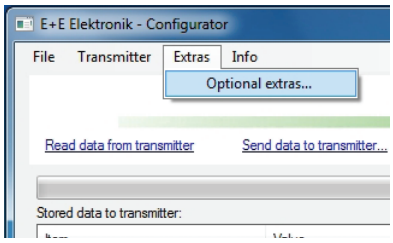

Select the COM-port number as shown in the device manager.

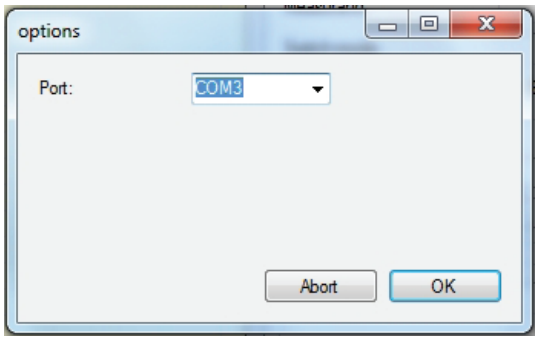

These settings are done only once and at the first start of the configuration software. The settings are stored for future use.

3. User Interface

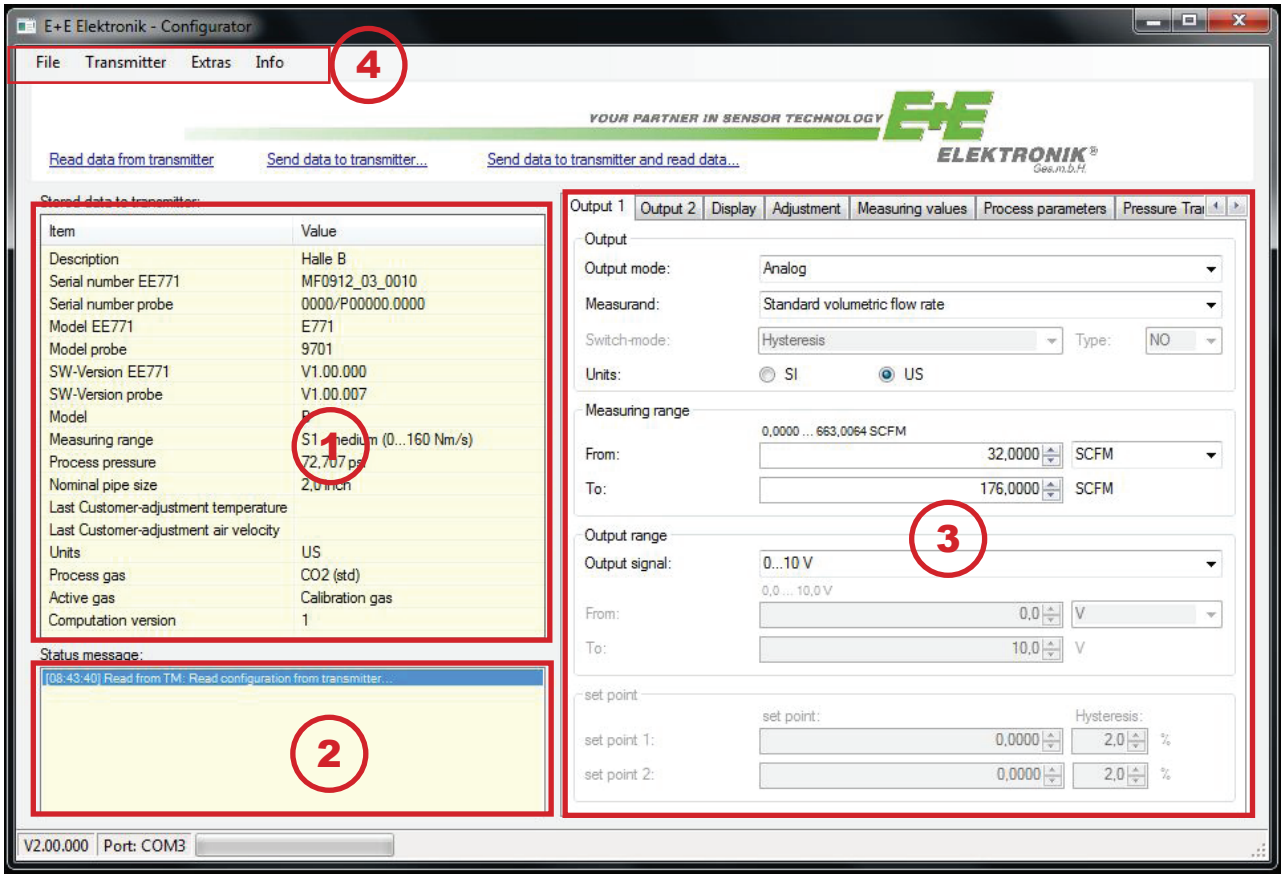

1 Basic information:
After retrieving the data from the transmitter, the basic information of the device is shown here.

2 Status message:
Here are the messages shown about the status and other information.

3 Input screen:
Input screen for the configuration or adjustment of the flowmeter.

4 Menu tool bar:
Selection of menu items.

4. Menu toolbar

4.1. File

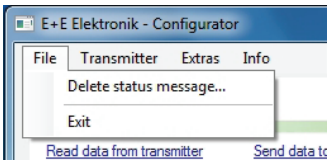

Delete status message deletes the status messages.

Exit closes the configuration software.

4.2. Transmitter

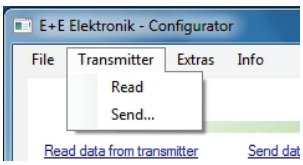

Read reads the actual configuration of the transmitter.

Send uploads the 'new' configuration to the transmitter.
The following settings are uploaded to the transmitter
- Units
- Output 1
- Output 2
- Display mode
- Pressure transmitter

Prior to uploading the 'new' configuration to the transmitter, a dialog box will show a summary of the changes. Click on the button 'OK' and the configuration will be uploaded to the transmitter; click 'Cancel' to cancel the operation.

4.3. Extras

Configurations of the VirtualCOM- interface (see page 23).

5. Input Screen

5.1. Output 1, Output 2

In this screen the actual settings of the transmitter for the output 1 and 2, resp. relay 1 and 2 are shown. The user can alter and upload these settings to the transmitter, together with other changes of the configuration.

5.1.1. Output mode

Here the mode of signal output can be determined.
Output 1: analogue or switch (relay) output
Output 2: switch (relay) or pulse output

NOTE:
In case the mode of output 1 is changed, the Jumper J1 on the board of the signal conditioning electronics has to be relocated as well (see page 25)

5.1.2. Measurand

Here is determined which measurand will be represented at the particular output.

5.1.3. Units

Choice of the engineering units of the selected measurand in either SI- (m/s; °C; m3/h) or US-units (SFPM; °F; SCFM).

NOTE:
The setting "Units" on the tabs for Output 1 and Output 2 are in sync with each other. If the units are changed on one of the output tabs, automatically the units on the other output tab are changed accordingly.

5.1.4. Output mode – analogue

Within the limits of measurement range and the scaling of the output, the analogue output can be freely configured and scaled. Either a standard output signal (0 – 5 V, 0 – 10 V, 0 – 20 mA, 4 – 20 mA) can be selected or a user defined range for the current / voltage output (e.g. 1 – 9 V).

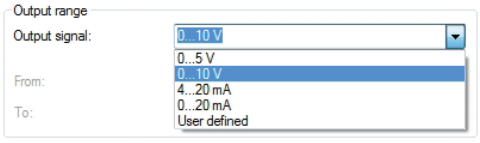

NOTE:
In case the analogue output is changed (from current to voltage or vice versa), the Jumper J2 on the board of the signal conditioning electronics has to be relocated as well (see page 25).

5.1.5. Output mode – switch (relay)

In the field for the “Switch-mode”, one can select “Hysteresis” or “Window”.

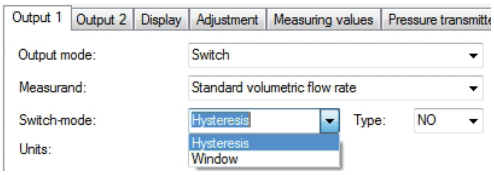

The field for “Type” is to determine the switch action of the relay, NO = Normally Open (activate to close), NC = Normally Close (activate to open).

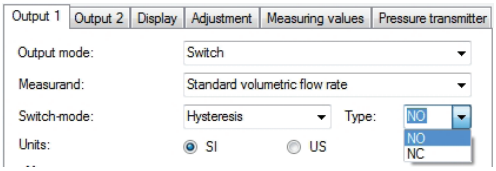

Under **“Measuring range”** in the field “From” the low value of the measuring range can be entered and in the field “To” the high value.
The hysteresis of the set point is entered as a percentage of the measuring range.
[measuring range] = high measuring value – low measuring value

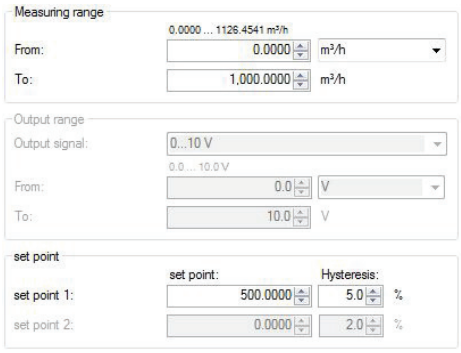

e.g. hysteresis
set point = 500 Nm³/h and reset point is 450 Nm³/h

Hysteresis = 50 Nm³/h = 0.5 % of measuring range

Hysteresis

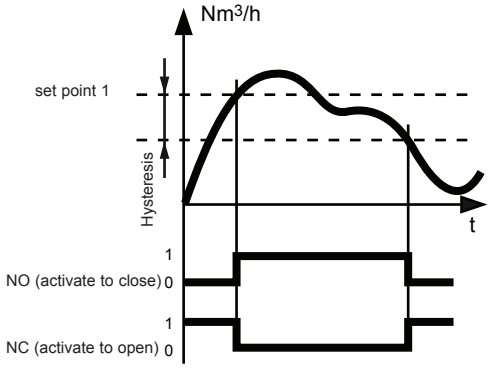

When the measurement value reaches **set point 1**, the relay will be activated. The value at the reset point is the value at set point 1 minus the hysteresis.

e.g. set point 1 = 100 Nm³/h and the hysteresis 5 Nm³/h.
the relay switches at 100 Nm³/h. The reset point is at 96 Nm³/h.

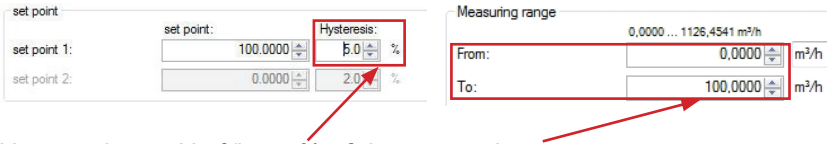

Hysteresis = 5 Nm³/h = 5% of the measuring range

Window

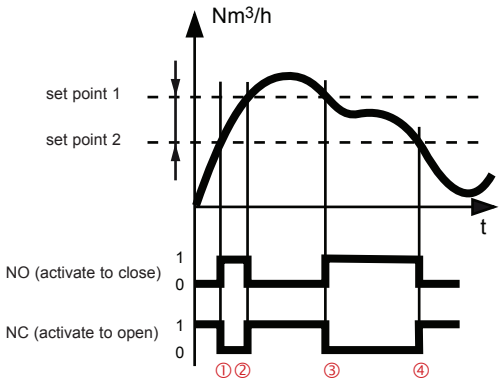

The relay is activated as long as the measuring value is between the values of **set point 1** and **set point 2**.
The hysteresis of each set point is fixed at 0.2% of the measuring range.

e.g.: set point 1 = 100 Nm³/h; set point 2 = 80 Nm³/h;
hysteresis of each set point is 1 Nm³/h (0.2% of 500 Nm³/h)



① 80 Nm³/h = set point 2
② 100 Nm³/h = set point 1
③ 99 Nm³/h = set point 1 - hysteresis
④ 79 Nm³/h = set point 2 - hysteresis

5.1.6. Output mode – pulse

If output 2 is configured for pulse, the measurand can be consumption only. Under “Pulse”, the duration of the pulse and the pulse value (Significance level of pulse) can be freely configured.

$$\frac{\text{Volume Flow [m}^3\text{/h]}}{\text{Pulse Value [m}^3\text{/Pulse]}} = \frac{\text{Number of Pulses}}{\text{Hour}}$$

The duration of the pulse can be set between 0.02 and 2 seconds.



e.g. Duration of pulse = 100ms; one pulse for each Nm³ consumed

The pulse – interval – ratio must be at least 1 : 2, meaning that the duration of the pulse interval must be at least twice the duration of the pulse itself.

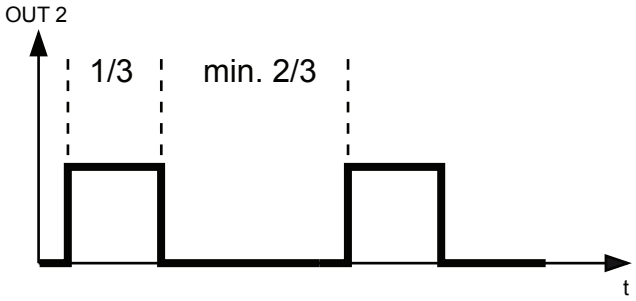

Calculation of the minimum “pulse value” or the maximum “pulse duration”.

IMPW_MIN = NORMV_MAX [m³/h] * IMPL [s] / 1200
IMPL_MAX = IMPW [m³] * 1200 / NORMV_MAX [m³/h]

IMPW	pulse value [m³]
IMPL	pulse length (duration) [s]
IMPW_MIN	minimum pulse value [m³]
IMPL_MAX	maximum pulse length (duration)
NORMV_MAX	expected maximum volume flow (Nm³/h)

5.2. Minimum flow shutdown

The minimum flow shutdown is switched on and off using the “active” checkbox.
If the output signal is ≤ than the set “Shutdown value”, the flowmeter issues 0 on the analogue output.

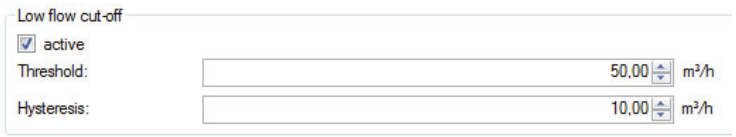

5.3. Display

If an optional display is installed, at the tab Display the following items can be entered:
Drop-down input field “Display-Mode”

- Single spaced
- Double spaced (default)

Checkbox “Backlight”

- Checked = ON
- Unchecked = OFF

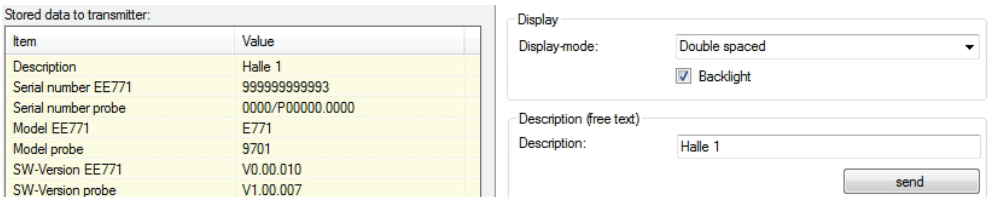

In the input field “Description (free text), a user specific name (max. 16 characters) for the transmitter can be entered.
e.g.: HALL 1
With the button “send” only the description will be uploaded to the transmitter.

5.4. Adjustment

The user can perform an adjustment for the measurands **normflow** and **temperature** in air.
The configuration software distinguishes between a 1-point and a 2-point adjustment automatically, depending on how many reference points for adjustments are entered.

The values entered for the customer's adjustment are stored in the electronics of the sensing probe and are therefore not lost if the electronics of the signal conditioning are replaced (see page 6)

If the checkbox "Performing customer-adjustment" is checked, the adjustment mode will be activated and the actual measuring value in the set interval automatically retrieved from the flowmeter (transmitter).

NOTE:
While the customer-adjustment is active all other pages, functions and commands are deactivated.

In the field "Adjustment" the measurand to be adjusted is selected.
In the field "Measuring value" the actual measurement value of the transmitter is indicated.
The update-interval can be set.

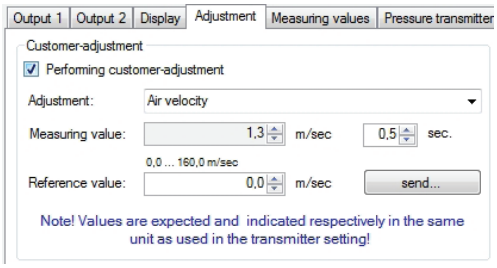

In the field "Reference value" the measurement value of the standard is entered.
After clicking the button "send" a control dialog box appears in which the values can be corrected if needed. Then the reference value will be uploaded to the flowmeter (transmitter) and is the adjustment procedure complete.
The reference point of the customer-adjustment must be within the determined measuring range.

The customer-adjustment results in a slight rotation of the characteristic line, in such a way that the measurement deviation at the upper and lower adjustment points equals zero.
The configuration software determines, depending on its position, if it is an upper or lower adjustment point.

5.4.1. 1-point adjustment

	lower adjustment point	upper adjustment point
possibility 1	0 - 50% of measuring range	100% of measuring range
possibility 2	0% of measuring range	>50 - 100% of m.r.

m.r. ... measuring range

upper adjustment point at 80% of measuring range
lower adjustment point automatically at 0% of m.r.

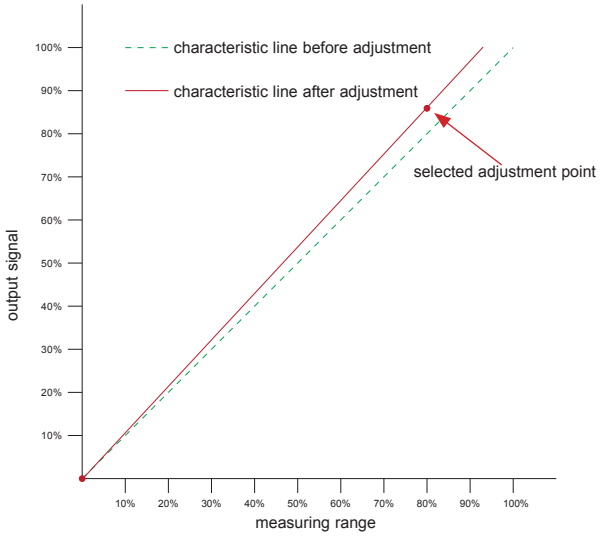

lower adjustment point at 20% of measuring range
upper adjustment point automatically at 100% of m.r.

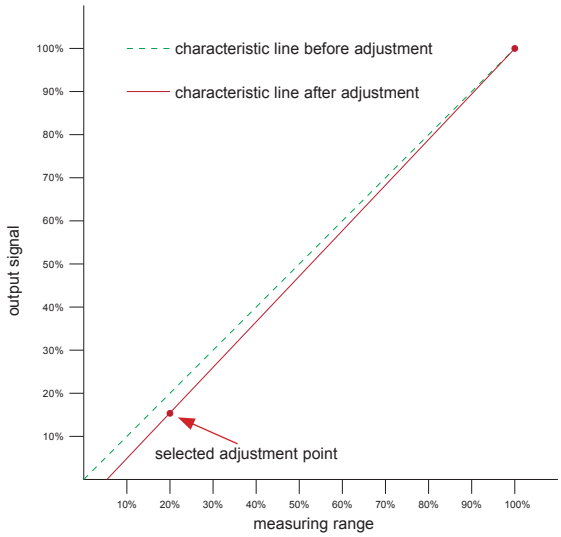

5.4.2. 2-point adjustment

With a 2-point adjustment procedure the lower adjustment point must be between 0 and 40% of the measuring range, and the upper adjustment point between 60 and 100% of the measuring range. If the adjustment point is between 40 and 60% of the measuring range, automatically a 1-point adjustment procedure will be executed instead.

	lower adjustment point	upper adjustment point
possibility 1	0 - <40% of m.r.	60 - 100% of m.r.
possibility 2	40 - <50% of m.r.	100% of m.r.
possibility 3	0% of m.r.	50 - <60% of m.r.

lower adjustment point at 10% of measuring range
upper adjustment point at 90% of measuring range

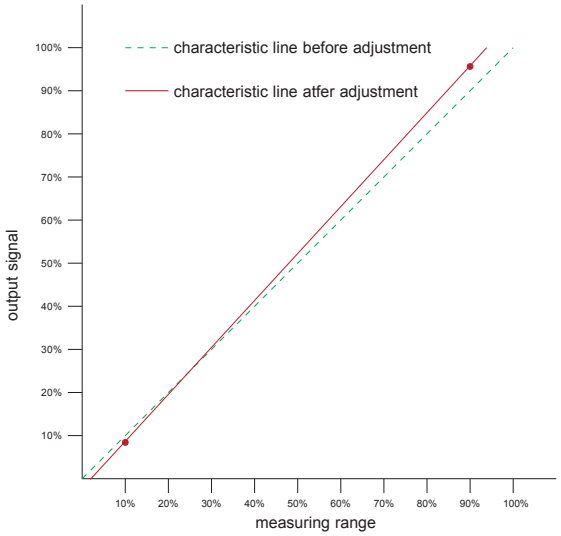

5.4.3. Reset to factory settings

Customer-adjustment can be reset to the factory settings by checking the appropriate checkbox and subsequently clicking the “reset” button.

5.5. Measuring values overview

The tab **measuring values** provides an overview of the retrieved actual measurement values of the flowmeter (transmitter). Clicking on “Fetch values” will retrieve the actual measurement and MIN / MAX values for flow, volume flow, temperature, mass flow and pressure (only if a pressure transmitter is connected) from the transmitter – additional the reading of the consumption meter is retrieved as well.
Checking the “Polling” checkbox will retrieve the measuring data from the transmitter at the selected interval.

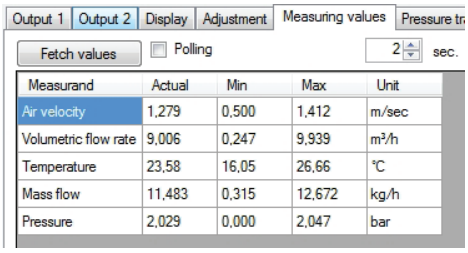

5.5.1. Reset of the MIN / MAX values

The MIN/ MAX values of each measurand, as stored in the flowmeter (transmitter), can be reset by checking the appropriate checkbox and subsequently clicking the “Clear MIN / MAX” button.

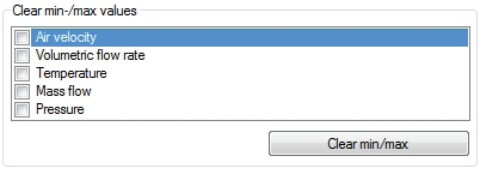

5.5.2. Reset of the consumption counter (totalizer)

The reading of the consumption meter can be reset by clicking the “Reset meter” button.

5.6. Setting up Process Parameters

In the tab **Process Parameters** you can change the Process gas (medium) and set the pressure compensation

5.6.1. Change the Process Gas

NOTE: This function is only active if the flow meter for a medium different from air has been ordered (see order code Medium in the data sheet)

Calibration-Gas: Is the gas (medium) in which the flow meter was calibrated in the factory. Unless otherwise specified, the flowmeter is calibrated at the factory always in air.

Process-Gas: Is the gas (medium) in the measured process. The adjustable process gases are set at the factory and can be selected from a list.

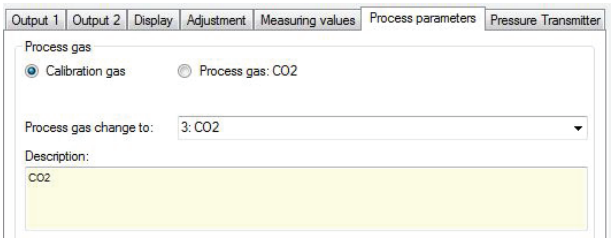

The flow meter is factory set to the ordered gas (medium).
If the setting for the process-gas modified or changed between calibration- and process gas, the changed setting has to be sent to the transmitter. Use “send data to the transmitter and read ...” button.
The “active gas” to which the flow meter is set, you can see in the field basic information.

Units	US
Process gas	CO2
Active gas	Calibration gas
Computation version	1

5.6.2. Changing the standard conditions

The flowmeter is factory-set to standard conditions conforming to DIN 1343.
Factory setting: P_0 = 1013.25 mbar, t_0 = 0°C (273.15 K)
The corrected volume flow measured value is calculated in line with the standard conditions set.



5.6.3. Pressure compensation

To achieve the highest measuring accuracy, the actual pressure can be entered in the field “pressure”.
The “Send” button is used only to send the process pressure to the transmitter.

5.7. External pressure transmitter for pressure compensation

In order to achieve the highest accuracy, the input from an external pressure transmitter will be very useful if the pressure fluctuates strongly (e.g. 3 to 10 bar (45 to 150 psi)). An absolute pressure transmitter with a 2-wire loop powered 4 – 20 mA output should be used.
On the tab “Pressure transmitter” the measuring range can be entered.

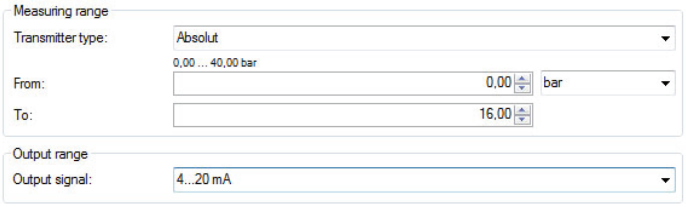

5.8. Bus configuration

If the flowmeter is equipped with an optional bus module, the data transfer rate and the network address can be set on the “Bus configuration” tab.
The network address set is only used when the dip switches on the flowmeter PCB are set to 255 (see page 14).

HEAD OFFICE:

E+E ELEKTRONIK Ges.m.b.H.
Langwiesen 7
A-4209 Engerwitzdorf
Austria
Tel: +43 7235 605 0
Fax: +43 7235 605 8
info@epluse.com
www.epluse.com

SALES OFFICES:

E+E CHINA / BEIJING
Tel: +86 10 84992361
info@epluse.cn www.epluse.cn

E+E CHINA / SHANGHAI
Tel: +86 21 61176129
info@epluse.cn www.epluse.cn

E+E GERMANY
Tel: +49 6172 13881 0
info@epluse.de www.epluse.de

E+E FRANCE
Tel: +33 4 7472 35 82
info@epluse.fr www.epluse.fr

E+E ITALY
Tel: +39 0331 177 31 02
info@epluse.it www.epluse.it

E+E KOREA
Tel: +82 31 732 6050
info@epluse.co.kr www.epluse.co.kr

E+E USA
Tel: +1 508 5303068
office@epluse.com www.epluse.com